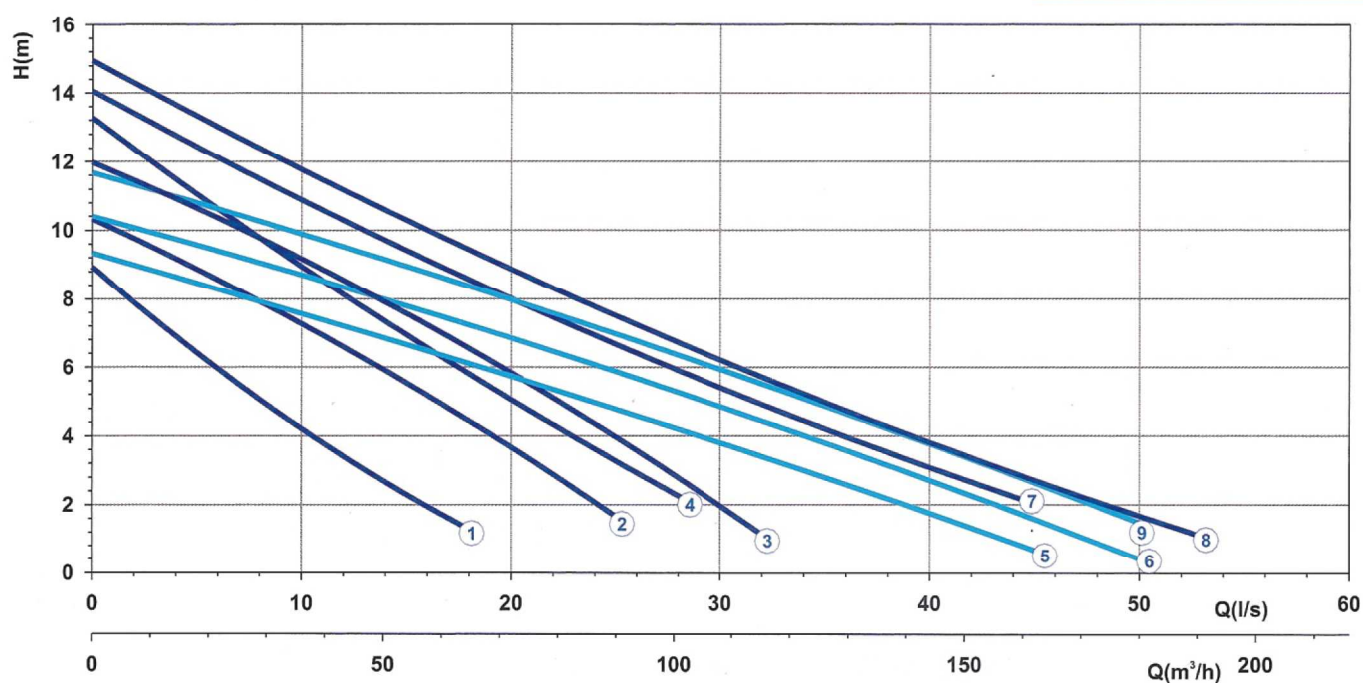
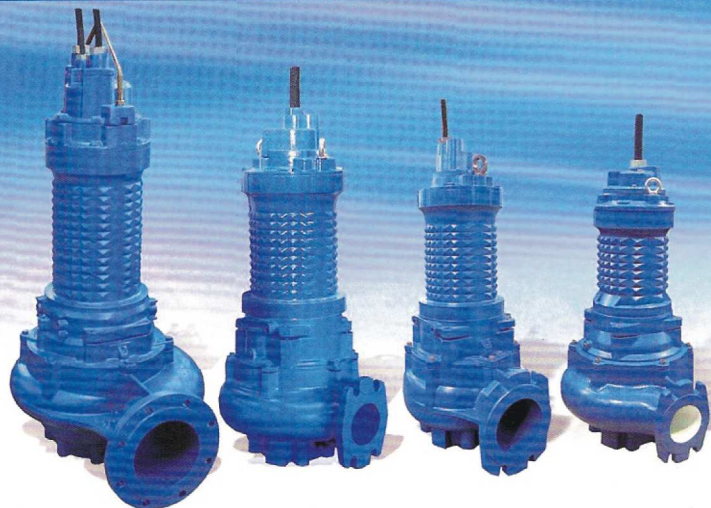
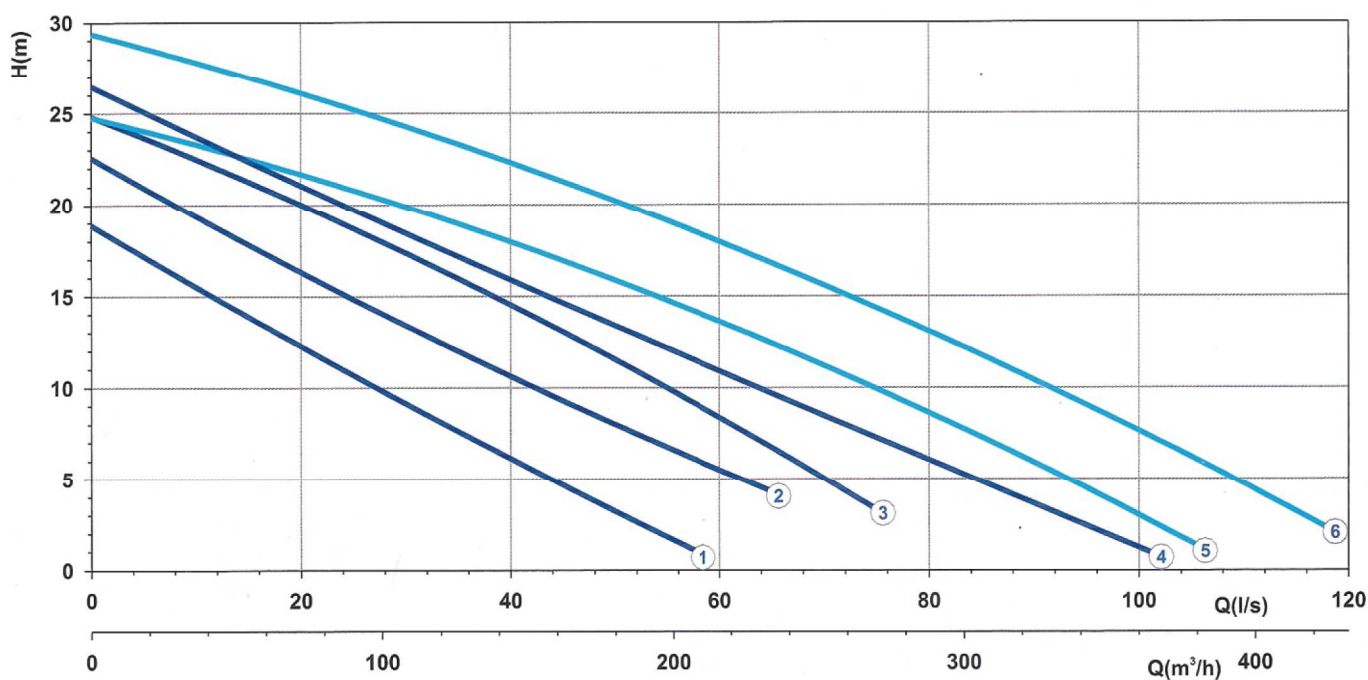



R.P.M. 1450


Curve N°	Code	Type	MOTOR			Power Supply	DN mm	Free Pass. mm	Weight Kg	code	
			Nominal P P2 (kW)	Nominal I I (A)	Starting I Is (A)						
1	7004188	G471M1M1-M65AB1	1	7	28,7	1ph 230V-50Hz	DN 80	65	49	7004187	
	7003550	G471T1M1-M65AA0	1,3	3,5	16,1	3ph 400V-50Hz	DN 80	65	49	7004189	
2	7005464	G409T1M2-M65AA0	2,3	5	22,5	3ph 400V-50Hz	DN 80	65	67	7005956	
3	7009184	G409T1M1-M65AA0	2,8	6,5	29,2	3ph 400V-50Hz	DN 80	65	67	7002792	
4	7003521	G409T1M1-M76AA0	2,8	6,5	29,2	3ph 400V-50Hz	DN 80	76	66	7008262	
5	7006615	G409T1M2-P90AA0	2,8	6,5	29,2	3ph 400V-50Hz	DN 100	90	67	7007627	
6	7000218	G409T1M1-P90AA0	2,8	6,5	29,2	3ph 400V-50Hz	DN 100	90	67	7007626	
7	7000203	G410R1M2-P78AA2	3,8	8	36	3ph 400/690V-50Hz	DN 100	78	117	7002797	
8	7000112	G410R1M1-P78AA2	3,8	8	36	3ph 400/690V-50Hz	DN 100	78	117	7008609	
9	7002949	G410R1M1-P90AA2	3,8	8	36	3ph 400/690V-50Hz	DN 100	90	85	7002809	


R.P.M. 1450


Curve N°	Code	Type	MOTOR			Power Supply	DN mm	Free Pass. mm	Weight Kg	code	
			Nominal P P2 (kW)	Nominal I I (A)	Starting I Is (A)						
1	7005181	G411R1M1-P78AA2	5	11	52,8	3ph 400/690V-50Hz	DN 100	78	161	7007499	
2	7009431	G413R1M2-P90AA2	10,1	22	121	3ph 400/690V-50Hz	DN 100	90	204	7007490	
3	7009232	G413R1M1-P90AA2	12,1	27	148,5	3ph 400/690V-50Hz	DN 100	90	204	7007489	
4	7006379	G413R1M3-S100AA2	14,1	30	165	3ph 400/690V-50Hz	DN 150	100	218	7007488	
5	7009937	G416R1M2-S100AA2	20,9	43,1	254	3ph 400/690V-50Hz	DN 150	100	450	-	
6	7009710	G416R1M1-S100AA2	20,9	43,1	254	3ph 400/690V-50Hz	DN 150	100	450	-	