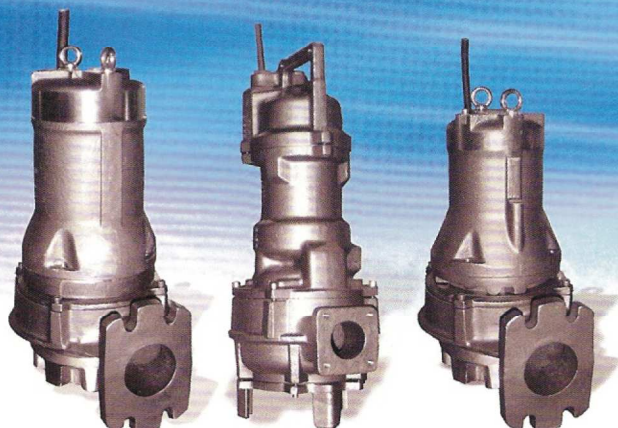
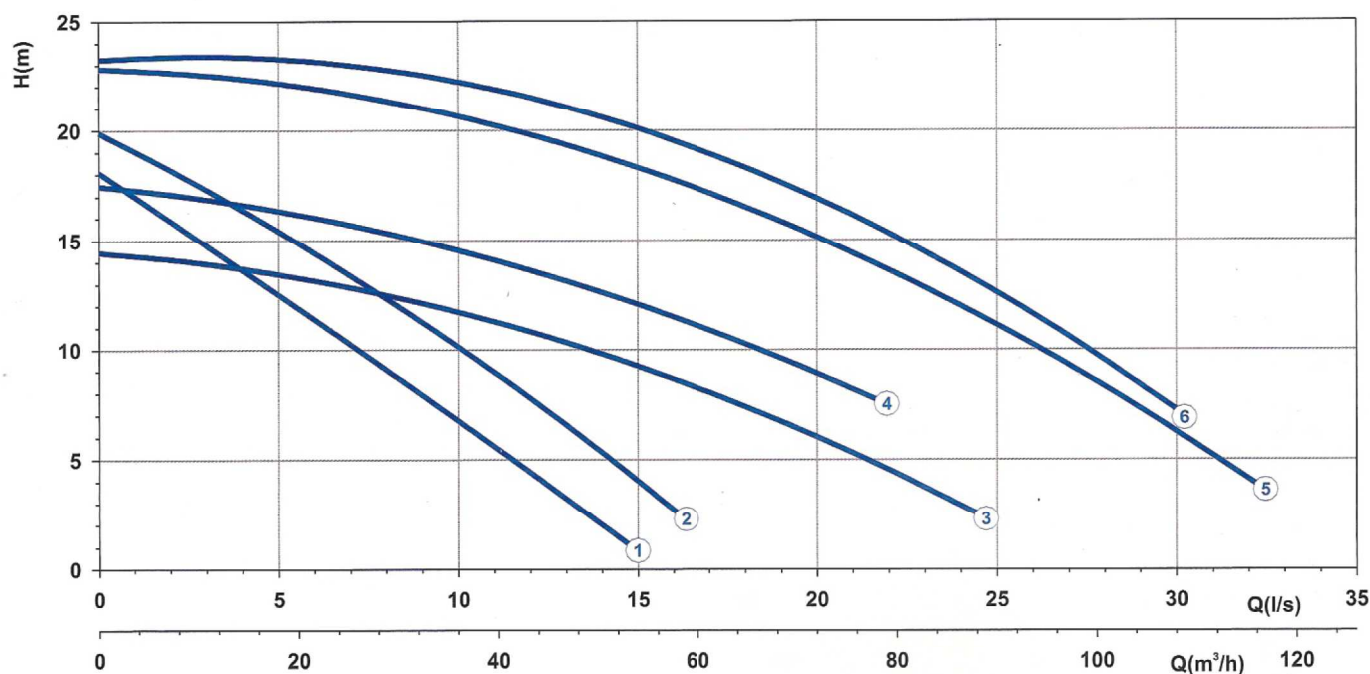


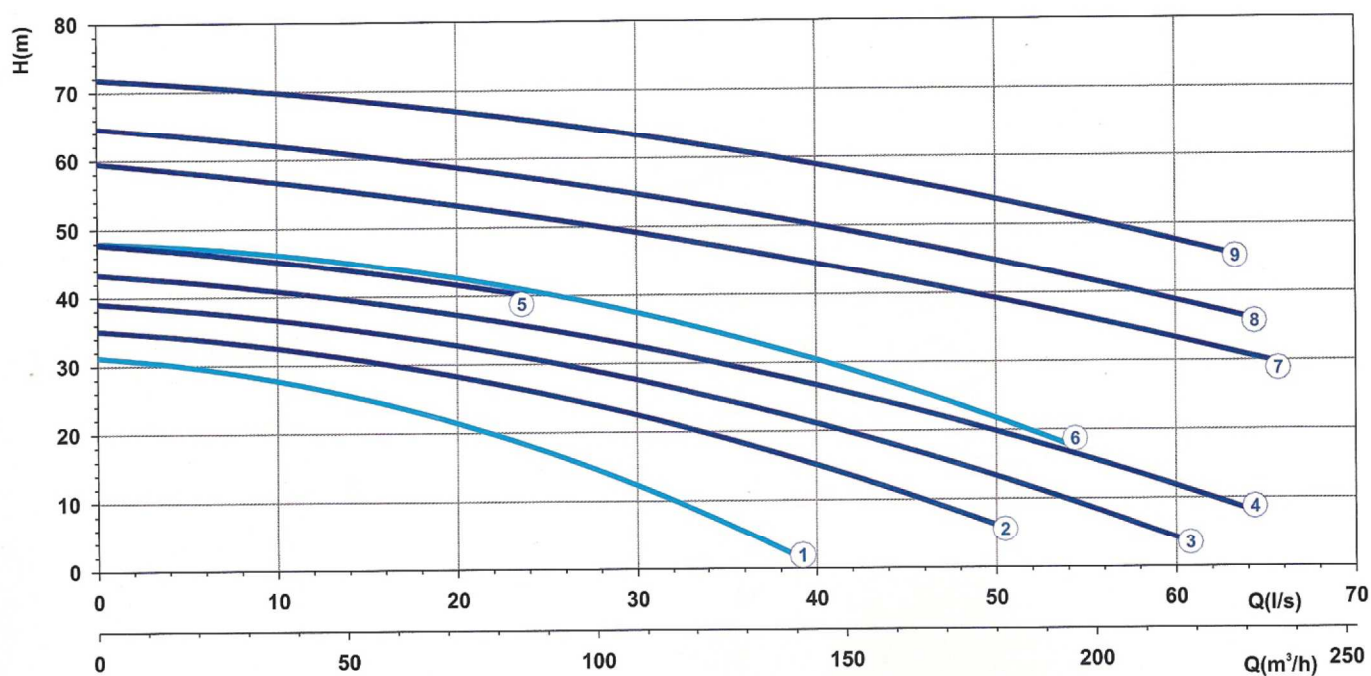

R.P.M. 2850


Curve N°	Code	Type	MOTOR			Power Supply	DN mm	Free Pass. mm	Weight Kg	code	
			Nominal P P2 (kW)	Nominal I I (A)	Starting I Is (A)						
1	7002181	X271M1M2-L40LB7	1,8	10	35	1ph 230V-50Hz	65	40	49	7006401	
	7005490	X271T1M2-L40LA4	2,4	5	21	3ph 400V-50Hz	65	40	49	7005892	
2	7005468	X271T1M1-L40LA4	2,9	6	25,2	3ph 400V-50Hz	65	40	49	7005712	
3	7005492	X209T3C3-L30LA4	3,2	6,5	31,8	3ph 400V-50Hz	DN 65	30	63	7005806	
4	7005356	X209T3C2-L30LA4	3,2	6,5	31,8	3ph 400V-50Hz	DN 65	30	63	7005357	
5	7005350	X210R3C2-M30LA5	5,7	12,5	73,7	3ph 400/690V-50Hz	DN 80	30	88	7008509	
6	7005349	X210R3C1-M30LA5	5,7	12,5	73,7	3ph 400/690V-50Hz	DN 80	30	88	7004186	

FOR FURTHER INFORMATION PLEASE CONTACT US:

TELEPHONE: (011) 792 9550/1/2, FAX: (011) 792 9553

e-mail: eeeaman@mweb.co.za Website: ernestfee.co.za


R.P.M. 2850


Curve N°	Code	Type	MOTOR			Power Supply	DN mm	Free Pass. mm	Weight Kg	code	
			Nominal P P2 (kW)	Nominal I I (A)	Starting I Is (A)						
1	7003334	X211R3C1-M30LA5	8,2	15,5	91,5	3ph 400/690V-50Hz	DN 80	30	150	-	
2	7003317	X213R3C4-P40LA5	13,8	29,5	174	3ph 400/690V-50Hz	DN 100	40	210	7007458	
3	7003172	X213R3C3-P40LA5	13,8	29,5	174	3ph 400/690V-50Hz	DN 100	40	210	7007456	
4	7003877	X213R3C2-P40LA5	18,2	34	193,8	3ph 400/690V-50Hz	DN 100	40	210	7007455	
5	7002300	X213R3C1-P40LA5	18,2	34	193,8	3ph 400/690V-50Hz	DN 100	40	210	7007454	
6	7005155	X216R3C1-P40LA5	22,4	40,1	237	3ph 400/690V-50Hz	DN 100	40	390	-	
7	7007727	X218R2C3-P50XA5	48,2	86,5	510,4	3ph 400/690V-50Hz	DN 100	50	364	-	
8	7007726	X218R2C2-P50XA5	48,2	86,5	510,4	3ph 400/690V-50Hz	DN 100	50	364	-	
9	7007725	X218R2C1-P50XA5	48,2	86,5	510,4	3ph 400/690V-50Hz	DN 100	50	364	-	